



Important!

Please give copies to all
your VW Technicians

Technical Bulletin

Subject: **Blower Motor, Noise or Vibration**


Group: **80**

Number: **01-01**

Model(s): **New Golf, New Jetta
New Beetle**

**1999▶
1998▶**

Date: **July 18, 2001**

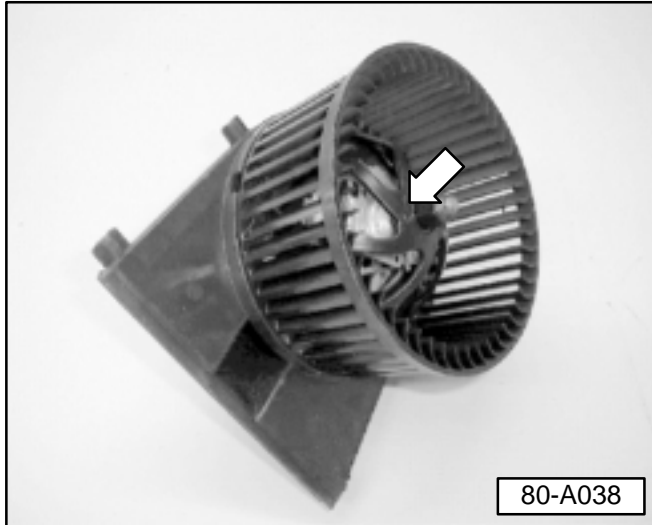

Condition

Excessive noise and/or vibration originates
from fresh air blower motor assembly.

Service

- ◀ if either condition is evident, replace the
blower motor assembly with improved unit,
Part No. 1J1 819 021B (identifiable by six
support legs to center hub; see arrow),

CAUTION!

*Part numbers are for reference only.
Always check with your Parts Dept. for
the latest parts information.*

- See Repair Manual, Repair Group 80, “Heat-
ing, Ventilation” for detailed information.

**For vehicles within the New Vehicle Lim-
ited Warranty, use the following:**

Part Identifier:	8530	
Golf/Jetta		
Remove / Install Glove Compartment:	68151900	70 TU
Remove / Install Blower Motor:	85301950	10 TU
New Beetle		
Remove / Install Glovebox:	68151900	20 TU
Remove / Install Blower Motor:	85301950	20 TU